1.455	.0840Z 02 APR 60.	TOPTSECHETET			
pate Scholarus organismos (marinismos)	DIRECTOR	and and the second control of the second	O PERATIONAL	- IMMEDIAIE	
1 (CH1)	(1,2,3,4)		OPERA:	OPERATIONAL IMMED	
1 F	C/C /5)				
	RR			IN 22025	
	TOR: 08402 02 APR 6	0		25X1	
	• • • • • • • • • • • • • • • • • • •	PRITY	, and the state was not a set when the service $\frac{1}{\sqrt{2}}$		
	02	/0550Z		25X1	
L	REF (OTT 64134) (NOT SENT) 25X1				
	1. THERE WAS NO APPRECIABLE DIFFERENCE BETWEEN FUEL PLOTS				
	AND HANDBOOK CURVE. BEGAN DESCENT EARLY DUE RAPID				
	DROP IN OXYGEN THEREFORE ELAPSED TIME AND HICONE FIGURES NOT				
	AVAILABLE. PREDICTED FIGURES WERE: (A) START DESCENT				
	8: 57, (195 GAL) (B) HICONE 9: 17, (150 GAL.)				
	2. OXYGEN DEPLETION MSN 6050 DUE TO LODGING OF PLASTIC				
	PARTICLES FROM FLIGHT FEEDING DISPENSER UNDER FLAPPER VALVE				
	OF FACE PIECE FEEDING ORIFICE. CONDITION CREATED IMPROPER				
	SEATING OF FLAPPER VALVE AND CONSEQUENT RAPID LOSS OF SHIP				
	OXYGEN SUPPLY. LEAK COMMENCED IMMEDIATELY AFTER REMOVAL OF				
	DISPENSER FROM FACE PIECE. THIS IS FIRST EXPERIENCE WITH PLASTIC				
ŕ	PARTICLES BUT SIGNIFICANT LEAKS OFTEN EXPERIENCED IN FEEDING				
)	ORIFICE WHEN RESIDUAL FOOD ON DISPENSER O.D. IS DEPOSITED ON				
	FLAPPER VALVE SEAT IN PROCESS OF REMOVING DISPENSER FROM FEEDING				
	ORIFICE.		c N	AKK	

Approved For Release 2006/10/14: CIA-RDP89B00569R000300120065-4

Copy No.

TOP SECHERE

REPRODUCTION BY OTHER THAN THE ISSUING OFFICE IS PROHIBITED.

Approved For Release 2006/10/14 : CIA-RDP89B00569R000300120065-4
IN 22025 PAG E 2

- 3. PILOT ADVISED THAT DISPENSER REMOVAL WAS DIFFICULT DUE TO BINDING AND REMOVAL BY FORCE OF BOTH HANDS WAS NECESSITATED.
 - 4. LOCAL FIX:
 - A. DISPENSERS BEING HAND SHAPED TO FACILITATE ORIFICE TRAVEL.
- B. PLASTIC PLUG SAME DIAMETER AS FEEDING ORIFICE HAS
 BEEN TIED TO EACH FACE PIECE LATCH STRING FOR ORIFICE INSERTION
 AFTER FEEDING.
 - 5. ALL FEEDING ORIFICES INSIDE FACE PIECE ARE CHAMFERED.
- 6. AS LEAK WAS OUTBOARD OF HELMET AND PILOT DESCENDED SAFE ALTITUDE PRIOR DEPLETION OF OXYGEN, HYPOXIA NOT SUSPECTED OR REPORTED AND POST HYPOXIA SYMPTOMS NOT OBSERVED.
 - 7. RECOMMEND:
- A. INFO PLASTIC PLUG FIX BE PASSED TO OTHER UNITS.

 PLASTIC PLUGS ARE OBTAINED FROM VALVE L.P. OXYGEN FILLER,

 AN-6024-5 (SHIPPING DUST PLUG).
- B. FEEDING DISPENSER TUBE BE MORE SECURELY ATTACHED TO DISPENSER CAP.
- C. FEEDING DISPENSER TUBE BE MADE OF MORE RESILIENT PLASTIC.
- D. FEEDING TUBE O.D. TO TAPER FROM 1/32" GREATER DIAMETER

 25X1

 THAN FACE ORIFICE TO 1/16" SMALLER THAN ORIFICE AT INSERTION END.

 25X1

8. REF (21924) AND (IN 21968)
IS IN COMMISSION.

END OF MESSAGE

TOP SECRET

THE FEEDING TOBE

THE FEEDING

25X1

25X1